

**TEST REPORT**

QF/7.8/35-WT

Page: 1 of 1

Customer's Name and Address :


<b>M/s. J. K. PAPER LTD.</b> <b>PLOT NO. 6/2, P.O. CENTRAL PUMP MILL,</b> <b>FORT SONGADH, GUNSADA – 394660</b> <b>TAL.: SONGADH, DIST.: TAPI, GUJARAT, INDIA.</b> <b>K/A. Mr. DURGESH MISHRA (MO.NO.: 93289 21078)</b>	Test Report No. : <b>PL/JK/24/0426</b> Issue Date : <b>09/01/2025</b> Customer's Ref. : <b>W.O. No.: 2248003178</b> <b>Date:04.07.2023</b>
---	---

<b>Sampling Location</b> : <b>SPS SCHOOL #</b>	Quantity/No. of Samples : <b>05 Ltr/01</b>
Description of Sample : <b>Drinking Water</b>	Protocol (Purpose) : <b>QC</b>
Date of Sampling : <b>28/12/2024</b>	Lab ID : <b>JK/2412/32</b>
Sampling By : <b>Pollucon Laboratories Pvt. Ltd.</b>	Packing/Seal : <b>Sealed</b>
Sample Receipt Date : <b>30/12/2024</b>	Date of Completion : <b>09/01/2025</b>
Date of Starting of Test : <b>30/12/2024</b>	

**OBSERVATION\*: SAMPLE FOUND CONFORMING AS PER IS 10500:2012 STANDARD FOR THE TESTED PARAMETERS.****RESULT TABLE**

SR. NO.	PARAMETERS	UNIT	RESULT	REQUIREMENT AS PER IS 10500:2012	TEST METHOD
1	Odour	--	Agreeable	Agreeable	IS 3025 (Part – 5)
2	Colour	Hazen	3.0	Max 5	IS 3025 (Part 4) Clause.5
3	Taste	--	Agreeable	Agreeable	IS 3025 (Part-8)
4	pH	--	7.71	6.5 - 8.5	IS 3025 (Part 11) Clause.2
5	Turbidity	NTU	0.12	Max 1	IS 3025 (Part – 10)
6	Total Dissolved Solids	mg/L	2.31	Max 500	IS 3025 (Part – 16)
7	Total Hardness	mg/L	58	Max 200	IS 3025 (Part 21) Clause.5
8	Residual Free Chlorine*	mg/L	Not Detected	0.2 Min if chlorine is used as disinfectant	IS 3025 (Part 26) Clause.7
9	Chloride	mg/L	44.9	Max 250	IS 3025 (Part 32) Clause.2
10	Total Alkalinity	mg/L	64	Max 200	IS 3025 (Part – 23)
11	Coliforms	/100 ml	Absent	Absent	IS 15185
12	Escherichia coli	/100 ml	Absent	Absent	IS 15185
13	Chemical Oxygen Demand (COD)	mg/L	8.0	Not Specified	APHA (23 <sup>rd</sup> Edition) 5220 B
14	Biochemical Oxygen Demand (BOD) (3 days at 27 °C)	mg/L	Not Detected	Not Specified	IS 3025 (Part-44)

# : Detail given by customer. Detection Limit: Residual Free Chlorine:0.1 mg/L, BOD :1.0mg/L.

  
**H. T. Shah**  
Lab. Manager

  
**Sweety Jain**  
Microbiologist

  
**Dr. Arun Bajpai**  
Lab Manager(Q)

Note: This report is subject to terms &amp; conditions mentioned overleaf.

- Recognised by MoEF, New Delhi Under Sec. 12 of Environmental (Protection) Act, 1986
- GPCR approved
- ISO 14001 : 2004
- OHSAS 18001 : 2007
- ISO 9001 : 2008
- Beshale R Auditor

"Pollucon House", Plot No.5/6, Opp.Balaji Industrial Society, Old Shantinath Silk Mill Lane, Near Gaytri Farsan Mart,  
Navjivan Circle,Udhana Magdalla Road, Surat-395007, Gujarat, India.

Phone : 0261-2635750, 0261-2635751, 0261-2635775, 07016605174, WEB: www.polluconlab.com, E. mail: pollucon@gmail.com, info@polluconlab.com

# સોનગઢ નગરપાલિકા

ફોર્ટ સોનગઢ ,તા. સોનગઢ જી.તાપી , પીન નં ૩૯૪૬૭૦  
નં. એમ .યુ. એન / જાહેર આરોગ્ય/વશી/, તારિખ : ૩૦/૦૧/૨૦૨૫ જા.નં.  
ફોન : ( ૦૨૬૨૪) ૨૨૧૬૮૯, E mail : npbranch\_son@yahoo.co.in

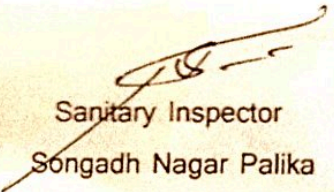
January 30 2025


## CERTIFICATE

We hereby certify that the Singhania Public School, C/o JK Paper Ltd, Unit: CPM, Fort SONGADH, Dist.: Tapi is having adequate sanitation facility infrastructure; after personally verifying the infrastructure, we are issuing this certificate for CBSE affiliation on their demand. The details of sanitation infrastructure are as under:

Sr.No.	Location		Remarks
1	Ground Floor I. Principal Office II. For Visitor III. MI Room IV. Conference Hall V. Girls' toilet/Urinal VI. Boys' toilet/ urinal	1 1 1 1 4 Bath rooms 3 Wash basins 5 urinal pots 3 wash basins 4 bath rooms	Adequate Infrastructure To cater the need of sanitation requirement
2	First Floor I. Girls' toilet/urinal II. Boys' toilet/urinal	4 bath rooms 3 wash basins 5 urinal pots 3 wash basins 4 bath rooms	
3	First Floor I. Girls' toilet/urinal II. Boys' toilet/urinal	4 bath rooms 3 wash basins 5 urinal pots 3 wash basins 4 bath rooms	

Looking to the strength of girls and boys the infrastructure is adequate. This infrastructure can cater the need for additional strength of about 50% of existing strength

  
Sanitary Inspector  
Songadh Nagar Palika  
Dist.Tapi

  
Technical Assistant  
Nagarpallika Songadh  
Dist.Tapi